

### DEPARTMENT OF TRANSPORTATION

**Federal Aviation Administration** 

**14 CFR Part 39** 

[Docket No. FAA-2023-0667; Project Identifier MCAI-2022-00735-A]

**RIN 2120-AA64** 

Airworthiness Directives; Pilatus Aircraft Ltd. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD) 2022-19-03, which applies to all Pilatus Aircraft Ltd. (Pilatus) Model PC-12, PC-12/45, PC-12/47, and PC-12/47E airplanes. AD 2022-19-03 requires incorporating new revisions to the airworthiness limitation section (ALS) of the existing airplane maintenance manual (AMM) or Instructions for Continued Airworthiness (ICA) to establish a 5-year life limit for certain main landing gear (MLG) actuator bottom attachment bolts and new life limits for the rudder bellcrank. Since the FAA issued AD 2022-19-03, the FAA has determined that new or more restrictive airworthiness limitations are necessary. This proposed AD would require revising the ALS section of the existing AMM or ICA for your airplane, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this NPRM by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to regulations.gov. Follow the instructions for submitting comments.
  - Fax: (202) 493-2251.

- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- Monday through Friday, except Federal holidays.

  AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA-2023-0667; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the

mandatory continuing airworthiness information (MCAI), any comments received, and

• Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m.,

other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For material that is proposed for IBR in this NPRM, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADs@easa.europa.eu; website: easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.
- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 901 Locust, Kansas City, MO 64106. For information on the availability of this material at the FAA, call (817) 222-5110.

  FOR FURTHER INFORMATION CONTACT: Doug Rudolph, Aviation Safety Engineer, General Aviation & Rotorcraft Section, International Validation Branch, FAA, 901 Locust, Room 301, Kansas City, MO 64106; phone: (816) 329-4059; email: doug.rudolph@faa.gov.

#### SUPPLEMENTARY INFORMATION:

# **Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under ADDRESSES. Include "Docket No. FAA-2023-0667; Project Identifier MCAI-2022-00735-A" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data.

The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

#### **Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Doug Rudolph, Aviation Safety Engineer, General Aviation & Rotorcraft Section, International Validation Branch, FAA, 901 Locust, Room 301, Kansas City, MO 64106. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### **Background**

The FAA issued AD 2022-19-03, Amendment 39-22172 (87 FR 57809, September 22, 2022), (AD 2022-19-03), for all Pilatus Model PC-12, PC-12/45, PC-12/47, and PC-12/47E airplanes. AD 2022-19-03 was prompted by MCAI originated by EASA, which is the Technical Agent for the Member States of the European Union. EASA issued AD 2021-0214, dated September 17, 2021 (EASA AD 2021-0214). The unsafe condition in EASA AD 2021-0214 is failure of MLG actuator bottom attachment bolts and failure to accomplish a new life limit for the rudder bellcrank. This prompted the FAA to issue AD 2022-19-03.

AD 2022-19-03 requires incorporating new revisions to the ALS of the existing AMM or ICA to establish a 5-year life limit for certain MLG actuator bottom attachment bolts and new life limits for the rudder bellcrank. The FAA issued AD 2022-19-03 to prevent MLG collapse during all phases of airplane operations, including take-off and landing and also to prevent rudder bellcrank failure, which could lead to loss of airplane control.

### Actions Since AD 2022-19-03 was Issued

Since the FAA issued AD 2022-19-03, EASA superseded EASA AD 2021-0214 and issued EASA AD 2022-0103, dated June 9, 2022 (EASA AD 2022-0103) (referred to after this as the MCAI), for all Pilatus Model PC-12, PC-12/45, PC-12/47, and PC-12/47E airplanes. The MCAI states that new or more restrictive tasks and limitations have been developed. These new or more restrictive airworthiness limitations include repetitive inspections for cracks in the lower main spar connection of the horizontal stabilizer. The FAA is issuing this AD to address failure of certain parts, which could result in loss of airplane control. Additionally, the actions required to address the unsafe condition in AD 2022-19-03 are included in "the applicable ALS," as defined in EASA AD 2022-0103. You may examine the MCAI in the AD docket at regulations.gov under Docket No. FAA-2023-0667.

#### **Related Service Information under 1 CFR Part 51**

EASA AD 2022-0103 requires certain actions and associated thresholds and intervals, including life limits and maintenance tasks. EASA AD 2022-0103 also requires doing corrective actions if any discrepancy (as defined in the applicable ALS) is found during accomplishment of any task required by paragraph (1) of EASA AD 2022-0103 and revising the approved aircraft maintenance program (AMP) by incorporating the limitations, tasks, and associated thresholds and intervals described in "the applicable ALS" as defined in EASA AD 2022-0103. This material is reasonably available because the interested parties have access to it through their normal course of business or by the

means identified in ADDRESSES.

#### **FAA's Determination**

These products have been approved by the aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI described above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

### **Proposed AD Requirements in this NPRM**

This proposed AD would retain none of the requirements of AD 2022-19-03. This proposed AD would require revising the ALS of the existing AMM or ICA for your airplane as specified in EASA AD 2022-0103, described previously, except as discussed under "Differences Between this Proposed AD and EASA AD 2022-0103." The owner/operator (pilot) holding at least a private pilot certificate may revise the ALS of the existing AMM or ICA for your airplane, and performance of this incorporation must be entered into the aircraft records showing compliance with this AD in accordance with 14 CFR 43.9(a) and 14 CFR 91.417(a)(2)(v). The record must be maintained as required by 14 CFR 91.417, 121.380, or 135.439.

### **Explanation of Required Compliance Information**

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2022-0103 by reference in the FAA final rule. Service information required by the EASA AD for compliance will be available at regulations.gov by searching for and locating Docket No. FAA-2023-0667 after the FAA final rule is published.

#### Differences Between this AD and EASA AD 2022-0103

Paragraph (2) of EASA AD 2022-0103 requires corrective actions in accordance with the applicable Pilatus maintenance documentation or contacting Pilatus for approved

instructions and accomplishing those instructions accordingly. Paragraph (3) of EASA AD 2022-0103 requires revising the approved AMP. Paragraph (4) of EASA AD 2022-0103 provides credit for performing actions in accordance with previous revisions of the Pilatus AMM. Paragraph (5) of EASA AD 2022-0103 explains that after revision of the approved AMP, it is not necessary to record accomplishment of individual actions for demonstration of AD compliance. This proposed AD would not require compliance with paragraphs (2) through (5) of EASA AD 2022-0103.

# **Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 1,030 airplanes of U.S. registry. Labor rates are estimated at \$85 per work-hour. Based on these numbers, the FAA estimates that revising the ALS of the existing AMM or ICA for your airplane would require about 1 work-hour for an estimated cost on U.S. operators of \$87,550 or \$85 per airplane.

### **Authority for this Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### **Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national

Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

# List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

# **The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

# § 39.13 [Amended]

- 2. The FAA amends § 39.13 by:
- a. Removing Airworthiness Directive 2022-19-03, Amendment 39-22172 (87 FR 57809, September 22, 2022); and
  - b. Adding the following new AD:

**Pilatus Aircraft Ltd.**: Docket No. FAA-2023-0667; Project Identifier MCAI-2022-00735-A.

#### (a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

# (b) Affected ADs

This AD replaces AD 2022-19-03, Amendment 39-22172 (87 FR 57809, September 22, 2022); (AD 2022-19-03).

# (c) Applicability

This AD applies to Pilatus Aircraft Ltd. Model PC-12, PC-12/45, PC-12/47, and PC-12/47E airplanes, all serial numbers, certificated in any category.

# (d) Subject

Joint Aircraft System Component (JASC) Code 0500, Time Limits/Maintenance Checks.

# (e) Unsafe Condition

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI states that failure to revise the airworthiness limitations section (ALS) of the existing aircraft maintenance manual (AMM) by introducing new and more restrictive instructions and maintenance tasks as specified in the component limitations section, which includes repetitive inspections for cracks in the lower main spar connection of the horizontal stabilizer, could result in an unsafe condition. The FAA is issuing this AD to address failure of certain parts, which could result in loss of airplane control.

# (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

### (g) Required Actions

- (1) Before further flight after the effective date of this AD, revise the ALS of the existing AMM or Instructions for Continued Airworthiness for your airplane by incorporating the requirements specified in paragraph (1) of European Union Aviation Safety Agency AD 2022-0103, dated June 9, 2022 (EASA AD 2022-0103).
- (2) The actions required by paragraph (g)(1) of this AD may be performed by the owner/operator (pilot) holding at least a private pilot certificate and must be entered into the aircraft records showing compliance with this AD in accordance with 14 CFR 43.9(a) and 91.417(a)(2)(v). The record must be maintained as required by 14 CFR 91.417, 121.380, or 135.439.

## (h) Provisions for Alternative Requirements (Airworthiness Limitations)

After the actions required by paragraph (g) of this AD have been done, no alternative requirements (airworthiness limitations) are allowed unless they are approved as specified in the provisions of the "Ref. Publications" section of EASA AD 2022-0103.

### (i) Alternative Methods of Compliance (AMOCs)

- (1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in § 39.19. In accordance with § 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD or email to: 9-AVS-AIR-730-AMOC@faa.gov. If mailing information, also submit information by email. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.
- (2) Global AMOC AIR-730-22-357, dated September 28, 2022, and Global AMOC AIR-730-23-054 R1, dated February 10, 2023, were approved as AMOCs for the requirements for AD 2022-19-03, and are approved as AMOCs for the requirements of paragraph (g) of this AD. Other AMOCs previously issued for the requirements of AD 2022-19-03 are not approved as an AMOC for the requirements of this AD.

### (j) Additional Information

For more information about this AD, contact Doug Rudolph, Aviation Safety Engineer, General Aviation & Rotorcraft Section, International Validation Branch, FAA, 901 Locust, Room 301, Kansas City, MO 64106; phone: (816) 329-4059; email: doug.rudolph@faa.gov.

### (k) Material Incorporated by Reference

- (1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.
- (2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

- (i) European Union Aviation Safety Agency AD 2022-0103, dated June 9, 2022.
- (ii) [Reserved]
- (3) For EASA AD 2022-0103, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADs@easa.europa.eu; website: easa.europa.eu. You may find this EASA AD on the EASA website at ad.easa.europa.eu.
- (4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 901 Locust, Kansas City, MO 64106. For information on the availability of this material at the FAA, call (817) 222-5110.
- (5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on April 5, 2023.

Christina Underwood, Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2023-07539 Filed: 4/10/2023 8:45 am; Publication Date: 4/11/2023]